

CITY OF LEE'S SUMMIT  
Development Services Department  
220 SE Green Street  
Lee's Summit, MO 64063  
(816)969-1200  
**OnlinePortal at DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #: PRCOM20241886  
Address: 251 NE ALURA WAY, LEES SUMMIT, MO 64064

---

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
<b>All Rough Inspection - Commercial</b>	Khanh Nguyen	Failed	Wednesday, February 04, 2026

Corrective Action Required:

1 Misc

SW4 shear walls:

- Nail all shear wall base plates per shear wall schedule
- Shear wall blocking panels not fully completed
- Nail together stud packs per 1/S531

Exterior combustible wall outside the stair enclosure shall be fire-block per IBC 718

Corrective Action Required:

2 FOURTH FLOOR

OK:

- Shower walls at all units
- Corridor and elevator lobby walls
- Housekeeping walls, except below

**\*\*Corrections below\*\***

- Move electrical panel outside of 1-hr lobby/housekeeping wall

Corrective Action Required:

3 THIRD FLOOR

OK:

- Pre-rock at corridor ceiling-OK
- OK to rock housekeeping wall adjacent to the elevator CMU wall for electrical equipment mounting
- Corridor

**\*\*Deficiencies below\*\***

320:

- At plumbing chase, protect penetration of floor/ceiling assembly
- Support waste stack at floor

301/303:

- At spaces adjacent to bathroom, complete top GB lid and fire caulk penetrations; protect penetration of floor with fire-stop assembly for 8" PVC

Housekeeping walls only, not including ceiling:

- Move electrical panel outside of 1-hr wall
- Provide vertical fire-blockings at max ten ft intervals and fb all gaps

Corrective Action Required:

4 SECOND FLOOR

- Pre-rock at corridor ceiling-OK
- OK to rock housekeeping wall adjacent to the elevator CMU wall for electrical equipment mounting
- OK to rock corridor and units, except unit area listed below

**\*\*Deficiencies below\*\***

220:

- At plumbing chase, provide GB top lid and fire-stop penetration of floor/ceiling assembly
- Support waste stacks at floor

206:

- Panel inside 1-hr wall

201:

- At spaces adjacent to bathroom, complete top GB lid and fire caulk penetrations; protect penetration of floor with fire-stop assembly for 8" PVC
- Support waste stacks at floor

Housekeeping walls only, not including ceiling:

- Move electrical panel outside of 1-hr wall
- Provide vertical fire-blockings at max ten ft intervals and fb all gaps

Corrective Action Required:

5 FIRST FLOOR

OK:

- Pre-rock at corridor ceiling (C-D/1 to 16.5)-OK to rock corridor ceiling and wall 2 ft down from ceiling.
- Shower walls at all units
- Electrical room walls

**\*\*Deficiencies below\*\***

Common deficiencies:

- Have engineer address support of the pool trusses not per 7/S532

132:

130:

128:

126:

124:

122:

-Nail corner studs inside exterior box-out wall

120:

-Complete exterior hose bib and protect water lines at top plates

-Need space for 2 layers of GB at tub shaft wall

-Provide GB top lid, fc gap, and protect penetrations

113:

-Complete exterior hose bib

115:

117:

-Nail corner studs inside exterior box-out wall

119:

121:

-Nail corner studs inside exterior box-out wall

123:

125:

127:

129:

-Anchor wall plate within 16" of hold down

131:

-Anchor SW2 within 16" of hold down

030:

028:

027:

026:

-Nail corner studs inside exterior box-out wall

-Complete truss repair

007:

-Protect plumbing at bottom wall plate

006:

009:

010:

013 and 013A:

-Supporting studs for the pool truss are cut at bottom

014:

-Anchor wall plate near break

029:

012:

-Complete elevator pit drainage

Corrective Action Required:

6 STAIR TOWER 1

\*\*THIS IS THE SOUTH STAIR TOWER\*\*

Corrective Action Required:

7 STAIR TOWER 2

\*\*THIS IS THE NORTH STAIR TOWER\*\*

**Comments:**