

## CITY OF LEE'S SUMMIT CODES ADMINISTRATION 220 SE GREEN ST. P.O.BOX 1600

PHONE: 816-969-1200

FAX:

816-969-1201

## **Inspection Summary**

Permit #: PRCOM20114952, Building Permit - Commercial Address: 203 SW JEFFERSON ST, LEES SUMMIT, MO 64063

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Outcome: Date:

Final Building

John Borns

Failed

Monday, August 06, 2012

Inspection - Commercial

Corrective Action Required

1 MISC

RESOLVE ISSUES OF OTHER DEPARTMENTS:

- WATER UTILITIES DEPARTMENT

- FIRE DEPARTMENT

- PLANNING & DEVELOPMENT DEPARTMENT

Corrective Action Required

2 MISC

NEC 330.30: NON-METALLIC ELECTRICAL WHIP NOT SECURED TO STRUCTURE WITHIN 12" OF ENTRY TO A/C DISCONNECT

ENCLOSURE.

Corrective Action Required

3 MISC

TEST ALL ELECTRICAL RECEPTACLES. OPEN GROUNDS FOUND

AT EXTERIOR RECEPT @ SW, 2ND FLOOR SW ROOM,

**BASEMENT CENTER & WEST CIRCUITS** 

Corrective Action Required

4 MISC

WATER CLOSETS AT RESTROOM REQUIRE COMMERCIAL TYPE

OPEN FRONT SEATS. ACCESSIBILITY REQUIRES FLUSH HANDLE ON FREE SIDE OF TANK. RECCOMMEND SEAL BASE

TO FLOOR.

Corrective Action Required

5 MISC

BOTTOM OF ACCESSIBLE RESTROOM MIRROR GLASS IS

ABOVE 40" MAXIMUM FROM FLOOR.

Corrective Action Required

6 MISC

WIRING CONNECTION FOR EXTERIOR LIGHTS MUST BE

HARD-WIRED INSTEAD OF PLUG-IN AT 2ND FLOOR NW ROOM

**CLOSET** 

Corrective Action Required 7 MISC

Corrective Action Required

8 MISC

Corrective Action Required

9 MISC

ELECT RECEPTS @ KIT SINK COUNTER NOT GFI-PROTECTED.

ELECT RECEPTS AT 1ST FLR RESTROOM NOT GFI PROTECTED

NEC 408.4: LABELING OF ELECTRICAL CIRCUIT POSITIONS AT PANEL(S): EACH BREAKER POSITION MUST BE LABELED. MUST BE LEGIBLE; SPECIFIC. IF PANEL SCHEDULE IS USED NUMBER POSITIONS ON PANEL FRONT PER SCHEDULE. NO DITTO MARKS OR CONTINUATION SYMBOLS EXCEPT @ MULTIPLE POLE BREAKERS. LABEL UNUSED BREAKERS "SPARE"

Corrective Action Required 10 MISC

Corrective Action Required 11 MISC

Corrective Action Required 12 MISC

UNUSED OPENINGS AT MAIN ELECTRICAL PANEL NOT CLOSED -- USE LISTED PLUGS

BEAM SUPPORT POST AT BASEMENT CENTER NEEDS SPICE REINFORCED.

ENSURE A/C CONDENSER ELECTRICAL CIRCUIT IS NOT OVER-AMPED (40A MAX).

## **Comments:**