

## Inspection Summary

Permit #: PRRES20131169, Building Permit - Residential

Address: 600 NW LILAC PL, Unit:B, LEES SUMMIT, MO 64081600 NW LILAC PL, Unit:C, LEES SUMMIT, MO 64081600 NW LILAC PL, Unit:A, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
<b>All Rough Inspection - Residential</b>	John Borns	Failed	Monday, January 27, 2014

Partial Correction

1	MISC	OK TO COVER WHEN READY WALLS AND CEILINGS AT: UNIT "A"; UNIT "B";
---	------	---

Corrective Action Required

2	MISC	<b>AT UNIT "C": FRE-BLOCKING -- ENSURE NO GAPS IN FRAMING ABOVE LAUNDRY RECESS WALL.</b>
---	------	--

Corrective Action Required

3	MISC	<b>AT UNIT "C": AT VANITY LOCATION AT NORTH WALL BEARING WALL STUDS ARE BORED ~ 1-7/8". 40% MAX ALLOWABLE IS 1-3/8". LISTED STUD SHOE IS APPROVABLE TO CORRECT.</b>
---	------	---

Corrective Action Required

4	MISC	<b>AT UNIT "C": KIT SE NM ELECT CABLE BORED THRU CORNER STUDS &lt; 1-1/4" FROM FACE @ REQUIRE SHIELD PLATE PROTECTION.</b>
---	------	--

**Comments: G.C. AND P.C. NOTE: ON FUTURE JOBS PROVIDE LISTING CERTIFICATION ON STUD SHOES UTILIZED TO REINFORCE OVERBORED/OVERNOTCHED STUDS.**