## PLANNING AND CODES ADMINISTRATION DEPARTMENT 220 SE GREEN STREET LEE'S SUMMIT, MO 64063 (816) 969-1200 FAX (816) 969-1201

## **Inspection Summary**

Permit #: PRRES20131169, Building Permit - Residential

Address: 600 NW LILAC PL, Unit:B, LEES SUMMIT, MO 64081600 NW LILAC PL, Unit:C, LEES SUMMIT, MO 64081600 NW LILAC PL, Unit:A, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Outcome: Date:

Occupancy Inspection - John Borns Failed Thursday, March 13, 2014

**Codes Residential** 

**Partial Correction** 

1 MISC FIRE/SECURITY SYSTEM SET-UP AND TESTING IN PROGRESS BY SPECIALTY

CONTRACTOR.

**Corrective Action Required** 

2 MISC SECURE PEX TUBING AT:

- WATER SERIVCE RISER IN MECHANICAL ROOM

- AT VALVES UNDER VANITY @ NORTH WALL

Corrective Action Required

3 MISC UFER G.E.C. TERMINATION TO BE ACCESSIBLE AND LOCATED.

Corrective Action Required

4 MISC NEC 370-20; IRC E3806.5-6 SET-BACK OF ELECTRICAL RECEPTACLE / SWITCH

BOXES: 1/4" MAXIMUM SET-BACK @ NON-COMBUSTIBLE SURFACES. SEE ALL

AT KITCHEN BACKSPLASH.

**Corrective Action Required** 

5 MISC NEC 422.31B CIRCUIT BREAKERS FOR APPLIANCES RATED OVER 300 VOLT

AMPS OR 1/8 HORSEPOWER: IF TO SERVE AS DISCONNECT MUST BE

LOCKABLE IF NOT WITHIN SIGHT OF PANELBOARD.

Corrective Action Required

6 MISC IRC P2717.3 BACKFLOW PREVENTION AT DISHWASHER: DRAIN DISCHARGE

LINE MUST RISE TO UNDERSIDE OF COUNTER AND BE SECURELY FASTENED (OR APPROVED ALTERNATE MEANS TO MAINTAIN HIGH POINT IN DISCHARGE

LINE.)

**Corrective Action Required** 

7 MISC

AC CONDENSER CIRCUIT IS OVER-AMPED PER STICKER ON UNIT: 30A VS 25A

**Corrective Action Required** 

8 MISC AT CRAWLSPACE SW TWO COPPER WATER PIPE RUNS HAVE STRAPS

DETACHED FROM STRUCTURE.

Rough Framing John Borns Passed Thursday, March 13, 2014
Inspection - Residential

**Comments:**