PLANNING AND CODES ADMINISTRATION DEPARTMENT 220 SE GREEN STREET LEE'S SUMMIT, MO 64063 (816) 969-1200 FAX (816) 969-1201

Inspection Summary

Permit #: PRCOM20122456, Building Permit - Commercial Address: 1611 NW OBRIEN RD, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Outcome: Date:

Occupancy Inspection - John Borns Failed Wednesday, May 14, 2014

Codes Commercial

Corrective Action Required

1 MISC CORRIDOR NOT READY FOR FINAL INSPECTION.

Corrective Action Required

2 MISC EXHAUST AT BATHROOMS TO BE TESTED.

Corrective Action Required

3 MISC Sec. 7-1408.1. Hinges.

Hinges for exterior swinging doors shall comply with the following:

Α.

At least two (2) wood screws, three (3) inches in length, penetrating at least one inch into wall structure shall be used. Solid wood fillers or shims shall be used to eliminate any space between the wall structure and door frame

behind each hinge.

Exception: Hinges within a door frame installed directly adjacent to a

sidelight.

В.

Hinges for out-swinging doors shall be equipped with mechanical interlock to

preclude the removal of the door from the exterior.

Corrective Action Required

4 MISC 404:

- ANTI-TIP PROVISION AT RANGE INOP

- DISPOSAL RECEPT NOT TIGHT TO BOX

Corrective Action Required

6 MISC 408:

- BA RECEPT NOT HOT FOR TEST

- RECEPT @ LR S WALL NOT GROUNDED

Corrective Action Required

7 MISC 409: BA RECEPT NOT HOT

Corrective Action Required

8 MISC 405: DISPOSAL RECEPT NOT TIGHT TO BOX

Corrective Action Required

9 MISC 403:

- "SOFT" RECEPT AT CLOSET

- LIGHT AT COURTYARD DOOR INOP

Corrective Action Required

10 MISC

401: DISPOSAL RECEPT NOT SOLID TO BOX

Corrective Action Required

11 MISC

NORTH ATTIC:

- CLOSE ALL HOLES/GAPS IN DRAFT STOP

- HVAC DUCT N OF N DRAFT STOP DAMAGED. CHECK FOR AIR FLOW

OBSTUCTION

Corrective Action Required

12 MISC

SUFFICIENCY OF ATTIC INSULATION VS. R-38 TO BE DETERMINED.

Corrective Action Required

13 MISC

IDENTIFY AND LABEL ALL ELECTRICAL EQUIPMENT AND LABEL CIRCUITS.

NEC 408.4: LABELING OF ELECTRICAL CIRCUIT POSITIONS AT PANEL(S): EACH
BREAKER POSITION MUST BE LABELED. MUST BE LEGIBLE, SPECIFIC. IF PANEL
SCHEDULE IS USED NUMBER POSITIONS ON PANEL FRONT PER SCHEDULE. NO
DITTO MARKS NOR CONTINUATION SYMBOLS EXCEPT @ MULTIPLE POLE

BREAKERS. LABEL UNUSED BREAKERS "SPARE".

Corrective Action Required

14 MISC

METTALIC ELECTRICAL FEEDER CONDUIT IN CONTACT WITH EARTH AT CRAWL SPACE: PROVIDE ENGINEER LETTER REGARDING SERVICABILITY OF CONDUIT

AT RUSTED LOCATIONS.

Alarm Test Joe Dir Partial Wednesday, May 14, 2014

Comments: