

Inspection Summary

Permit #: PRCOM20141078, Building Permit - Commercial

Address: 3351 SW KESSLER DR, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
Rough Framing Inspection - Commercial	Mark Harding	Partial	Monday, March 16, 2015

Corrective Action Required

1	Misc 1	GARAGE-framing 1ST -partial, HOLD DOWN 2ND-partial, HOLD DOWN 3RD-PARTIAL HOLD DOWN FLOOR TRUSS DRILLED CHECK FIX. 4TH-(NOTE:SCREWS NOT HOLD DOWNS) MISSING 1 SCREW EAST EXTERIOR WALL, 1 SCREW NOT FULLY SEATED WEST END SHEAR WALL NAILING - EXTERIOR -OK INTERIOR- PARTIAL CHECK REMAINING AT ALL TRADES INSPECTION
---	--------	---

Above Ceiling Inspection	Mark Harding	Failed	Monday, March 16, 2015
-------------------------------------	--------------	--------	------------------------

Corrective Action Required

1	LOWER LEVEL	GARAGE - CORRIDOR PLUMBING PLATES NEEDED WHERE 3" DWV ENTERS WALL AND CEILING -SPRINKLER PIPING SCREWED TO FLOOR JOIST NEED TO MOVE OR LOWER FOR ROCK. - EAST END :WATER PIPING, 3" DWV , AGAINST FLOOR JOIST REMOVE TO INSTALL ROCK OR PROVIDE APPROVED FIRE COLLARS AND LISTING FOR INSPECTION.
---	-------------	---

Comments: