

PLANNING AND CODES ADMINISTRATION DEPARTMENT
220 SE GREEN STREET
LEE'S SUMMIT, MO 64063
(816) 969-1200 FAX (816) 969-1201

Inspection Summary

Permit #: PRCOM20141079, Building Permit - Commercial
Address: 3361 SW KESSLER DR, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
All Rough Inspection - Commercial	Mark Harding	Failed	Friday, May 15, 2015

Corrective Action Required

1	FIRST FLOOR	units only- 2112 plate bolts, hold down, drilled truss dryer boxes 2110 -plate bolts, clean out laundry 2106- 2108 2104-dryer vents, bath fan, exterior stud drilled for exterior light replace or add 2102-install ground north wall hvac units 02;04;06
---	-------------	---

Corrective Action Required

2	SECOND FLOOR	units only--check all HVAC INCOMPLETE 2201-dryer vents , HVAC, 02-hvac tape joints 04 hold down not against top plate 06- drill joist sprinkler line 09-hvac 10- 11-line set caulk, driller holes in truss sprinkler line 12-angle wall rock, floor, support dwv
---	--------------	--

Corrective Action Required

3	THIRD FLOOR	-2301 ac line set 2300 rock arch, missing floor truss, bath fans , hvac, hole furn room 2302-line set, switchbox ext door, dryer 2304 sprklr drilled #2, 2305 4" roof drain collar, caulk ac, hold down NE , dwv support 2306- hvac , low voltage puddy pads 2307 tape hvac, hvac, electrical box exterior wall. 4" roof drain
---	-------------	---

<p>Corrective Action Required</p> <p>4 FOURTH FLOOR</p>	<p>2308 truss sprkl, dryer</p> <p>2309- puddy pads north party wall</p> <p>2313-4" drain,electrical ceiling-wall , elect ext wall</p> <p>2312-sprkl bath #2, eletrical incomplete, dryer</p> <p>corridor lighting ? ceiling no electrical, house panel?</p>
<p>Corrective Action Required</p> <p>5 Misc 1</p>	<p>2412- bath fans hvac, electrical</p> <p>2413-puddy kit wall, sprkl plate stair wall,smoke drop, exterior lights</p> <p>2409 hanger truss, support all dwv</p> <p>dwv kit walls, support all dwv and roof drains.</p> <p>inspection stopped- incomplete level for inspection</p> <p>hvac and electreical incomplete</p> <p>dryer boxes inspected 1-4</p> <p>1st layer shower wall inspected</p> <p>1st layer 2hr wall unit side inspected</p> <p>elevator ok to rock 1-3</p> <p>strap 4" roof drain 4th floor north stair .</p> <p>-ALLROUGH</p> <p>EXTERIOR GROUNDLEVEL SOFIT OK TO COVER.</p>

Comments: