

PLANNING AND CODES ADMINISTRATION DEPARTMENT  
220 SE GREEN STREET  
LEE'S SUMMIT, MO 64063  
(816) 969-1200 FAX (816) 969-1201

## Inspection Summary

---

Permit #: PRRES20151238, Building Permit - Residential  
Address: 265 SE COYLE DR, LEES SUMMIT, MO 64063

---

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

---

Inspection:	Inspector:	Outcome:	Date:
<b>Electrical Service Inspection - Residential</b>	Mike Copeland	Passed	Wednesday, September 09, 2015

Corrective Action Required

1	Misc 1	GROUNDING CONDUCTOR NOT CONNECTED TO UFFER GROUND
---	--------	---------------------------------------------------

<b>Gas Piping Inspection - Residential</b>	Mike Copeland	Passed	Wednesday, September 09, 2015
--------------------------------------------	---------------	--------	-------------------------------

<b>Gas Service Inspection - Residential</b>	Mike Copeland	Passed	Wednesday, September 09, 2015
---------------------------------------------	---------------	--------	-------------------------------

<b>All Rough Inspection - Residential</b>	Mike Copeland	Failed	Wednesday, September 09, 2015
-------------------------------------------	---------------	--------	-------------------------------

Corrective Action Required

2	Misc 1	-FIREBLOCK FIRESTOP FUR OUTS, TUB TRAPS -BEARING STUDS DRILLED MORE 40% REQUIRE STUD SHOES -TOP PLATES DRILL MORE THAN 50% REQUIRE STRAPS WITH 4 NAILS EACH SIDE -NOTCH IN THE MIDDLE THIRD OF JOIST SPAN 1st FLOOR NW BED -GARAGE, INSTALL PLATE BOLTS PER PORTAL DETAIL AND WITHIN 12" OF END OF A PLATE SECTION -INSTALL 1000 lb. STRAPS GARAGE PORTAL PER DETAIL -PROTECT 10 GUAGE CONDUCTOR WEST WALL GARAGE AT I
---	--------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

BEAM STUD SUPPORT

-REAR WALL DINING ROOM, NOT BUILT PER DETAIL, HEADER NOT EXTENDED TO CORNERS, straps ETC. HAVE ENGINEER ADDRESS

-HAVE ENGINEER ADDRESS CORNER STUD FRAMING AT FOYER. STUDS CUT FOR FRONT PORCH HEADER, NOT ENOUGH CORNER STUD CONNECTION

-VENT BASEMENT WET BAR

DO NOT INSULATE

Corrective Action Required

3

**Comments:**