

PLANNING AND CODES ADMINISTRATION DEPARTMENT
220 SE GREEN STREET
LEE'S SUMMIT, MO 64063
(816) 969-1200 FAX (816) 969-1201

Inspection Summary

Permit #: PRRES20151618, Building Permit - Residential
Address: 324 SE MILL CREEK DR, LEES SUMMIT, MO 64063

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
Electrical Service Inspection - Residential	Mike Copeland	Passed	Wednesday, October 07, 2015

Gas Service Inspection - Residential	Mike Copeland	Failed	Wednesday, October 07, 2015
---	---------------	--------	-----------------------------

Corrective Action Required

1	G2417 INSPECTION, TESTING AND PURGING	NO TEST PRESSURE, 2ND FLOOR FIREPLACE NOT INSTALLED
---	---------------------------------------	---

All Rough Inspection - Residential	Mike Copeland	Failed	Wednesday, October 07, 2015
---	---------------	--------	-----------------------------

Corrective Action Required

1	Misc 1	-CORNER STUDS AT GARAGE PORTAL HAVE BEEN NOTCHED AT THE BASE FOR ANCHOR BOLTS. INSTALL ADDITIONAL STUDS. -FIREBLOCKING USED AT GARAGE FUR DOWN IS NOT 3/4". INSTALL ADDITIONAL FIREBLOCKING. -COMPLETE DRAFTSTOPPING FOR OPEN WEB FLOOR TRUSSES BY SEALING AROUND BY SEALING AROUND PENETRATIONS. -INSTALL SECURITY BLOCK REAR DOOR. -INSTALL INSULATION SHIELD AROUND B VENT AT FIRST FLOOR MECH CHASE. -SEAL LOW VOLTAGE PENETRATIONS BETWEEN FLOORS. -SECURE FIREPLACES TO FRAMES AND SET GAS LINE FOR SECOND FLOOR. -FLASH PLUMBING VENTS. -MASTER CLOSET AND LAUNDRY LIGHTING CONDUCTORS WITHIN 6 FEET OF ATTIC ACCESS REQUIRE RUNNING BOARDS.
---	--------	---

- PROTECT CONDUCTORS ABOVE MAIN PANEL.
- FRONT PORCH FRAMING, DOUGLAS FIR IN CONTACT WITH CONCRETE.
- BUILDING CLEANOUT LOCATED UNDER BASEMENT STAIR LANDING AND IS NOT ACCESSIBLE.

OKAY TO INSULATE

Corrective Action Required

2

Comments: