## PLANNING AND CODES ADMINISTRATION DEPARTMENT 220 SE GREEN STREET LEE'S SUMMIT, MO 64063 (816) 969-1200 FAX (816) 969-1201

## **Inspection Summary**

Permit #:PRRES20152158, Building Permit - Residential Address: 2400 SW HICKORY LN, LEES SUMMIT, MO 64082

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
Electrical Service Inspection - Residential	Mark Harding	Passed	Thursday, February 04, 2016
Gas Piping Inspection - Residential	Mark Harding	Passed	Thursday, February 04, 2016
Gas Service Inspection - Residential	Mark Harding	Failed	Thursday, February 04, 2016
Corrective Action Required 1 Misc 1 NO PSI			
All Rough Inspection - Residential	Mark Harding	Failed	Thursday, February 04, 2016
Corrective Action Required  1 Misc 1 -install Plumbing protection plates where required			

-fire stopping through out, garage chase, flu Chase 1st

floor, Chase at the great room wall, dinning room dead space,  $% \left( 1\right) =\left( 1\right) \left( 1\right)$ 

2nd floor flue chase from attic.

-Seal all plate and floor penetrations

-structurally tie wall at top plates over refrigerator to LVL

Headers into cased openings of dining room.

- no trimmers under headers in dinning room

-Support DWV plumbing 4 foot on center throughout

-Stair wall, wall bracing first floor nail with approve nails, nail into

top plate and bottom plate per plans. -Nail double truss over master per plans. Add double stud under double truss at master closet wall.

- -support truss per plans over mstr and joist hanger where required.
- nail wall bracing master bedroom wall
- Seal holes in floor front tub shower next to master vanity
- -Fire stop front bedroom wall at ceiling line.
- -install header to support trust over master closet door.
- Block all joist at cantilevers and bearing points over I-beams and walls.
- Support double rim over basement egress window to foundation, wall header over window has no trimmers.
- Install three studs between the windows rear wall of first floor.
- Support truss over mstr bath and bedroom Install -4 studs at pantry for point load.

Check point loads from 2nd to bsmt

-install Continuous tie at top plates at dinning room, no top plates are connecting.

no psi gas line do not cover.

## **Comments:**