PLANNING AND CODES ADMINISTRATION DEPARTMENT 220 SE GREEN STREET LEE'S SUMMIT, MO 64063 (816) 969-1200 FAX (816) 969-1201

Inspection Summary

Permit #:PRCOM20150016, Building Permit - Commercial Address: 518 NW MURRAY RD, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Outcome: Date:

Occupancy Inspection - John Borns Not Ready Thursday, June 09, 2016

Codes Commercial

Corrective Action Required

1 Misc 1 COMPLETE FINISH SITEWORK

Corrective Action Required

2 Misc 1 RESOLVE ANY PLANNING ISSUES

RESOLVE ANY FIRE DEPT ISSUES
RESOLVE ANY WATER DEPT ISSUES

RESOLVE ANY PUBLIC WORKS DEPT ISSUES

Corrective Action Required

3 Misc 1 ROOFTOP:

-PARAPET CUT OPEN AT ROOF NW

-SLIPSHEETS REQ'D AT BALLY CONDENSING UNIT -DESIGNATE EF'S WITH PERMANENT STICKERS

-HINGE KITS REQ'D ON GREASE EF'S

-ALL GAS PIPING DRIP LEG CAPS MUST BE REMOVEABLE -TYPE 2 EF DISCHARGES UNDER ROOF OVERHANG

-FINAL CLEAN ROOF SURFACE OF UNUSED MATERIAL AND

DEBRIS

Corrective Action Required

4 Misc 1 RTU-7:

-NEW GAS PIPE TO BE PAINTED

-CLAMP EXISTING GAS PIPE TO SUPPORTS

-ELECT RECEPT REQUIRED -FINAL CLEAN ROOF

Corrective Action Required

5 Misc 1 ABOVE COOLER AT ELEVATED WALKWAY LEVEL:

-UNTERMINATED MC COIL ABOVE -UNUSED OPENING AT J-BOX -STRAP MC WITHIN 12" OF BOXES Corrective Action Required

6 Misc 1 COMPLETE ELEVATOR CONSTRUCTION

Corrective Action Required

7 Misc 1 GUARD AND HANDRAIL REQUIRED AT EXTERIOR STAIR AT SW

Corrective Action Required

8 Misc 1 GUARD REQUIRED AT INTERIOR STAIR SW

Corrective Action Required

9 Misc 1 BACKFLOW PROTECTION REQ'D AT ICEMAKER, COFFEE MAKERS,

CARBONATED BEVERAGE FEED LINE, ETC

Corrective Action Required

10 Misc 1 RESTROOM AT ELEVATOR LOBBY: WATER CLOSET CLEARANCE TO

WALL NOT 16"-18"

Corrective Action Required

11 Misc 1 CHASE AND FIRESTOPPING REQ'D AT ELEVATOR MACHINE ROOM

Corrective Action Required

12 Misc 1 ELECT WHIPS AT CONDENSERS EXTERIOR NW: SECURE TO

BUILDING WITHIN 12" OF ENTRY TO DISCONNECT.

Corrective Action Required

13 Misc 1 SEAL ALL EXTERIOR WALL OPENINGS

Corrective Action Required

14 Misc 1 PLACE PERMANENT CIRCUIT SCHEDULES AT ELECTRICAL PANELS.

DESIGNATE PANELS PER DRAWINGS.

Corrective Action Required

15 Misc 1 OCCUPANCY STATUS: OK TO SET UP FOR BUSINESS. NO

RESIDENTS OR PUBLIC PRIOR TO APPROVAL.

Comments: NO FINAL ISSUES FOUND AT ELEVATOR PIT.