

PLANNING AND CODES ADMINISTRATION DEPARTMENT
220 SE GREEN STREET
LEE'S SUMMIT, MO 64063
(816) 969-1200 FAX (816) 969-1201

Inspection Summary

Permit #:PRCOM20161080, Building Permit - Commercial
Address: 521 SE 2ND ST, Unit:B, LEES SUMMIT, MO 64063

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

| | | | |
|-------------------------------------|------------|-----------|-----------------------------|
| Inspection: | Inspector: | Outcome: | Date: |
| Above Ceiling Inspection | John Borns | Not Ready | Tuesday, September 13, 2016 |

Corrective Action Required

| | | |
|---|--------|---|
| 1 | Misc 1 | COMPLETE ALL WORK ABOVE CEILING INCLUDING S.A. DIFFUSERS BEFORE REQUESTING ABOVE-CEILING INSPECTION. PLACE NO TILE BEFORE INSPECTION EXCEPT THOSE THAT ARE REQUIRED TO MOUNT DEVICES SUCH AS EXIT SIGNS, ETC. ENSURE HVAC FLEX DUCT IS INSTALLED PER AIR DIFFUSION COUNCIL GUIDELINES (ATTACHED). |
|---|--------|---|

| | | | |
|---------------------------|------------|--------|-----------------------------|
| In-wall Inspection | John Borns | Failed | Tuesday, September 13, 2016 |
|---------------------------|------------|--------|-----------------------------|

Corrective Action Required

| | | |
|---|--------|--|
| 1 | Misc 1 | NEC 334-10 SECURING / SUPPORT OF MC ELECTRICAL CABLE: SECURE WITHIN 12" OF BOXES AND SUPPORT AT 6' MAX INTERVALS THEREAFTER. |
|---|--------|--|

Corrective Action Required

| | | |
|---|--------|---|
| 2 | Misc 1 | IPC 305 PROTECTION OF COPPER PIPING AT PENETRATION OF STEEL FRAMING MEMBERS: INSTALL GROMMETS OR OTHER APPROVED PROTECTION FROM SHARP EDGES & DISSIMILAR METAL. SEE NITROUS OXIDE AND OXYGEN PIPING ONE LOCATION. |
|---|--------|---|

Corrective Action Required

| | | |
|---|--------|--|
| 3 | Misc 1 | HOLE NOT CUT FOR ONE ELECT RECEPTACLE BOX. |
|---|--------|--|

Corrective Action Required

| | | |
|---|--------|---|
| 4 | Misc 1 | ENSURE STEEL BOCA PLATES ARE NOT IN CONTACT WITH COPPER WATER PIPE -- DISSIMILAR METALS |
|---|--------|---|

Comments: