

**PUBLIC WORKS ENGINEERING DIVISION**

**Inspection Summary**

Permit #: PRPWFC20162083, Public Works Infrastructure Permit - Commercial  
WATER UTILITIES FACILITY  
Address: 1200 SE HAMBLLEN RD, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection Item:

<b>Inspection:</b>	<b>Inspector:</b>	<b>Outcome:</b>	<b>Date:</b>
PW-Commercial Curb Inspection Informational	Brice Lawson	Partial	Thursday, May 18, 2017

1 Brice Lawson 01/23/2017 4:19 PM  
Epic Concrete installed 23' of curb on the west side of Hamblen Rd. at CI 10A. They installed 36' of curb on the east side of Hamblen Rd. at CI 50B. They used KCMMB 4000K concrete mix. The rock was compacted, dowels were installed and expansion material was installed. This was required after these structures were installed and storm line 50 was installed under Hamblen Rd.

**Corrective Action Required**

2 Any broken or damaged curb should be replaced.  
Brice Lawson 02/02/2017 1:58 PM  
Remove and replace approx. 57' of curb on the east side of Hamblen Rd. This includes the new curb that was recently installed and curb to the north. The curb that was recently installed shows signs of pour consolidation/voids and the curb to the north shows recent damage. It appears this damage was caused by tracking a machine over the curb.

On the west side of Hamblen Rd. the backfilled needs to be removed so an inspection can be completed. Areas that are exposed show signs of pour consolidation and voids.

Brice Lawson 05/18/2017 9:30 AM

The curbs on the east and west sides of Hamblen Rd that were installed around the new CI throats have been grouted so the curbs are acceptable.

Today She Digs It removed approx. 20' of curb on the east side of Hamblen Rd. where it



Vault

May 18, 2017

Informational

1 Brice Lawson 04/17/2017 2:12 PM  
She Digs It submiited the backflow preventer test data sheet for the 6" backflow preventer.

Informational

2 Brice Lawson 05/17/2017 10:14 AM  
It appears that the backflow preventer and vault have been properly installed.

**Comments:**

---