

PLANNING AND CODES ADMINISTRATION DEPARTMENT
220 SE GREEN STREET
LEE'S SUMMIT, MO 64063
(816) 969-1200 FAX (816) 969-1201

Inspection Summary

Permit #:PRRES20170306, Building Permit - Residential

Address: 2232 SW BURNINGWOOD LN, LEES SUMMIT, MO 640822234 SW BURNINGWOOD LN, LEES SUMMIT, MO 640822236 SW BURNINGWOOD LN, LEES SUMMIT, MO 640822230 SW BURNINGWOOD LN, LEES SUMMIT, MO 64082

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
All Rough Inspection - Residential	Dale Carter	Failed	Monday, July 31, 2017

Corrective Action Required

1	Misc	<ol style="list-style-type: none">1. Grounding conductor from UFA enters meter bank, but is not connected to anything.2. Firestopping is incomplete. For example: every 10' along common walls; at ceiling level over each side of laundry rooms; sole- and top-plate penetrations; at either side of the short stair leading to the upper/rear bedrooms; etc.3. Corner nailing.4. Fully nail joist hangers.5. Support DWV every 4'.6. DWV piping run across attic access opening. <p>UNIT 2230: Nail-guard plates for elec. wire at a few locations throughout unit.</p> <p>UNIT 2232: Missing ridge support.</p> <p>UNIT 2236: Hole in common-wall fire-rock at top of stairs to upper floor.</p>
---	------	--

Electrical Service Inspection - Residential	Dale Carter	Failed	Monday, July 31, 2017
--	-------------	--------	-----------------------

Corrective Action Required

1	Misc	Grounding conductor from UFA enters meter bank, but is not connected to anything.
---	------	---

**Rated Assembly
Inspection**

Dale Carter

Failed

Monday, July 31, 2017

Corrective Action Required

1

Misc

- Hole in common-wall fire-rock at top of stairs to upper floor in Unit 2236.
- Firestop every 10'.

Comments: