

# Development Services Department

220 SE Green Street Lee's Summit, MO 64063

(816) 969-1200 FAX (816) 969-1201

## Inspection Summary

---

Permit #:PRRES20171753, Building Permit - Residential

Address: 1824 SW BLACKSTONE PL, LEES SUMMIT, MO 64082

---

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

---

Inspection:	Inspector:	Outcome:	Date:
<b>Electrical Service Inspection - Residential</b>	Dale Carter	Passed	Wednesday, October 18, 2017

<b>All Rough Inspection - Residential</b>	Dale Carter	Failed	Wednesday, October 18, 2017
---	-------------	--------	-----------------------------

### Corrective Action Required

- |   |      |  |
|---|------|--|
| 1 | Misc | <ol style="list-style-type: none"><li>1. Perform street clean-up before further inspection.</li><li>2. BSMT: Anchor columns.</li><li>3. BSMT: Shim full-width of beams.</li><li>4. BSMT &amp; 1st FLR: Firestop stair landings (vert-to-horiz).</li><li>5. BSMT &amp; 1st FLR: Support bottoms of stair stringers, at landings.</li><li>6. BSMT &amp; 1st FLR: (7) studs at point load beside stair landing.</li><li>7. 1st FLR: Sill-plate anchors in garage.</li><li>8. 1st FLR: Solid-block beside main duct, inside chase (loosely suspended insulation is not adequate).</li><li>9. 1st &amp; 2nd FLR: Nail all joist hangers.</li><li>10. 2nd FLR: Install snow-blocking.</li><li>11. ROOF: Missing ridge and purlin supports over the southeast and the southwest bedrooms.</li><li>12. ROOF: Purlin struts along the south side of the house are not constructed in a 'T' configuration, as required on the plans.</li></ol> |
|---|------|--|

Comments: