Development Services Department

220 SE Green Street Lee's Summit, MO 64063 (816) 969-1200 FAX (816) 969-1201

Inspection Summary

Permit #:PRRES20173028, Building Permit - Residential Address: 4069 NE CHAPEL MANOR DR, LEES SUMMIT, MO 64064

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:		
Electrical Service Inspection - Residential	Khanh Nguyen	Passed	Monday, December 11, 2017		
Gas Service Inspection - Residential	Khanh Nguyen	Passed	Monday, December 11, 2017		
All Rough Inspection - Residential	Khanh Nguyen	Failed	Monday, December 11, 2017		
Corrective Action Require	ed				
1 Misc	FRAM -Min 6 end of -Instal -Ancho (missin -Ancho -Add n -Nail c -Comp -Instal -Brace -Instal bed/b -Block securit -Temp	 FRAMING: -Min 6'8" headroom clearance requird above stair near the front end of the diagonal lvl -Install full supports under lvl and all other beams at stair wall -Anchor within 12" of breaks and at interval no more than six ft (missing anchors) -Anchor garage portal wall sill plates -Add more nailing to H-frames or install straps -Nail corner studs w/ 16d@12" oc or equivalent nailing -Complete fur out for b vent in garage -Install collar ties above laundry&garage area -Brace lvl beam above living rm from rotation -Install hanger support for ceiling beam connections above front bed/bath wall Block rear door stud and fill in gap at strike plate side per security code -Tempered glass window required adjacent to rear door -Fireblock fireplace space from roof 			

PLUMBING: -Protect water line at master shower -Protect water at front bed/bath wall

***OK TO INSULATE

Erosion (Control	Khanh Nguyen	Failed	Monday, December 11, 2017
Corrective 1	e Action Requir DCM2 Erosion	Control DEFIC		CONTROL INSTALLATION. REPAIR EROSION HER INSPECTIONS UNTIL ADEQUATE PROVIDED.

Comments: