Development Services Department

220 SE Green Street Lee's Summit, MO 64063 (816) 969-1200 FAX (816) 969-1201

Inspection Summary

Permit #:PRRES20172630, Building Permit - Residential Address: 1337 NE BRANDYWINE RD, LEES SUMMIT, MO 64064

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Outcome: Date:

Electrical Service Khanh Nguyen Failed Thursday, April 26, 2018

Inspection - Residential

Corrective Action Required

1 Misc -Locate and ground to ufer with#4 copper grounding electrode

conductor

-Ground service to water service line

All Rough Inspection - Khanh Nguyen Failed Thursday, April 26, 2018
Residential

Corrective Action Required

1 Misc FRAMING:

-Plan on site. Check bearing wall at master bed area

-Install the straps at inner side of garage portal brace walls. See

plan

-Anchor and protect garage steel column

-Provide space for R15 insulation at garage wall return air

-Brace all double 2x10 ceiling beam and LVL beam ends from

rotation

-Nail wall intersection at master bath shower

-Flashing above window trim at rear

-Double ceiling header joist above kitchen

-Install flashing at stoop in such way that water not getting into the basement space below and concrete not in contact with

wood

-Fb fireplace space from roof. Use 3/4" sheathing or approved

materials

-Fb wall from furdown. Use 3/4" sheathing or other approved

materials

-Solidblock all joist ends above I beams

- -Toe nail joists to basement top and sill plates per code (3-8d)
- -Complete framing at basement shower and fb wall from ceiling as required
- -Solidblock cantilevered joists below master bed
- -Fb basement bedroom closet wall space from furdown space

MECHANICAL:

- -Install fireplace and connect gas line
- -Dryer duct exceed length limit
- -Pan off return air space from ceiling furdown space above basement bedroom closet

ELECTRICAL:

- -Protect wiring where secured within 1.25 of ceiling nailing surface. Look inside bed closet and near smoke alarm outside bedrooms
- -Receptacle at rear accessible from and reachable within 6.5 ft of grade

PLUMBING:

- -Install loop vent per code
- -Vent roof flashing

**DO NOT INSULATE

Erosion Control Khanh Nguyen Failed Thursday, April 26, 2018

Corrective Action Required

1 DCM1 Erosion Control INSTALL EROSION AT REAR CORNER OF LOT

NO FURTHER INSPECTIONS WILL BE PERFORMED UNTIL EROSION

CONTROL IS INSTALLED AND IN COMPLIANCE.

Comments: