
PUBLIC WORKS ENGINEERING DIVISION

Inspection Summary

Permit #: PRSITE20180515, Development - Site

Abundant Life Food Pantry

Address: 1300 SW JEFFERSON ST, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection Item:

Inspection:	Inspector:	Outcome:	Date:
DEI-Erosion Sediment Control (ESC) Inspection Informational	Matt Munger	Partial	Friday, April 27, 2018
1	Matt Munger 04/16/2018 10:21 AM The Contractor was working on installing the silt fence. I spoke with Randy (Superintendent) about making sure the silt fence is trenched in properly.		
Corrective Action Required			
2	Matt Munger 04/18/2018 2:27 PM The construction entrance has not been installed and the silt fence that was staked in was not trenched in properly. I spoke with Randy (Pearce) and he stated they would have someone in tomorrow to trench in the silt fence and install the construction entrance. I informed him the construction needs to have the larger rip rap and should be at least 50' in length. I also informed Randy to install gutter devices in the curb inlets in the church parking lot and place a cinder block between the device and inlet.		
Partial Correction			
3	Matt Munger 04/19/2018 1:17 PM I walked along the silt fence that was installed and observed that it had been trenched into the ground. The construction entrance has not been installed yet.		
Informational			
4	Matt Munger 04/20/2018 8:51 AM I spoke with Randy about the construction entrance, he stated they would try and have it in on Monday. We spoke about the project and I let him know if he had any questions to contact me and we will work through anything that comes up.		
Informational			
5	Matt Munger 04/23/2018 3:00 PM The construction entrance has not been installed yet.		
Informational			

6 Matt Munger 04/24/2018 10:00 AM

The construction entrance has been installed with larger rip rap in place.

Informational

7 Matt Munger 04/25/2018 3:20 PM

The workers had the silt fence on the backside down temporarily while working. I spoke with Randy onsite and he said they would get it back up.

Informational

8 Matt Munger 04/27/2018 2:00 PM

Gutter devices were in place in the parking lot inlets. The workers had the silt fence down on the back side of the property.

Comments:
