Development Services Department

220 SE Green Street Lee's Summit, MO 64063 (816) 969-1200 FAX (816) 969-1201

Inspection Summary

Permit #:PRRES20172630, Building Permit - Residential Address: 1337 NE BRANDYWINE RD, LEES SUMMIT, MO 64064

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Outcome: Date:

All Rough Inspection - Khanh Nguyen Failed Tuesday, May 15, 2018

Residential

Corrective Action Required

L Misc FRAMING:

- -Provide plan on site. Check bearing wall at master bed area
- **take off roof load from walls not designated as bearing wall
- -Install flashing at stoop in such way that water not getting into the basement space below and concrete not in contact with wood
- -Solidblock cantilevered joists below master bed
- **DONT FORGET TO INSULATE AND SEAL THE CANTILEVERED FLOOR. YOU MUST INSULATE THE CANTILEVERED JOIST SPACE. PLEASE

MECHANICAL:

- -Pan off return air space from ceiling furdown space above basement bedroom closet
- **go down to basement bedroom, then to closet, and look up. The return air space is opened to the ceiling space below. Pan underneath the joists to isolate the RA from ceiling space

ELECTRICAL ADDENUM:

-The guy who re-routed the dryer duct damaged the wiring. Two things must be done: rewire the circuit and make sure to reroute the wiring so that the wiring is not in contact with the hot dryer duct.

**OK TO INSULATE

Electrical Service	Khanh Nguyen	Passed	Tuesday, May 15, 2018
Inspection - Residential			

Comments: