CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 FAX(816)969-1201

Inspection Summary

Permit #: PRRES20181747 Address: 2533 SW RIVER TRAIL RD, LEES SUMMIT, MO 64082

This work has been inspected and the inspection results noted below. Please call for re-inspection once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
All Rough Inspection - Residential	Mark Harding	Failed	Wednesday, November 14, 2018
Course ative Antions Donusing du			

Corrective Action Required:	
1 Misc	 -Flue clearance at 2nd floor flue chase. Complete fur down for chase. Fire stop with 3/4" plywood not siding. flue clearance on 1st,2nd floors. -Perlin over rear rear bedroom. no purlin installed , raftes have a vaulted ceiling load on them. -Secure wardlfex per code at fireplace. incomplete -Lvl header over mud room not on the plans. ** This is a 2 story wall, plan shows a single window a tripple is installed (over 4') provide Engineering on the header installed not according to plans. -Back wall of front bedroom is not a bearing wall on the plans. Lands in the middle of the floor joist below. Check rear bedroom wall ceiling joist land on non-bearing wall. -Missing dbl joist over kitchen. -Missing ebam post in bsmt at stair wall.
	 shows a single window a tripple is installed (over 4') provide Engineering or the header installed not according to plans. Back wall of front bedroom is not a bearing wall on the plans. Lands in the middle of the floor joist below. Check rear bedroom wall ceiling joist land on non-bearing wall. -missing dbl joist over kitchen.

Comments: