

CITY OF LEE'S SUMMIT
Development Services Department
220 SE Green Street
Lee's Summit, MO 64063
(816)969-1200
DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRCOM20170399

Address: 3520 SW HOLLYWOOD DR, Unit:2, LEES SUMMIT, MO 64082

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
Rated Assembly Inspection	Brandon Kalwei	Not Ready	Friday, November 15, 2019

Corrective Action Required:

1 Misc

For second and third floors sheet rock

** seams throughout 2nd and 3rd floor, screws are too close to the seams and Also screws are breaking paper making screw distances too far apart on walls and ceilings

** sheet rock seams are too close together throughout 3rd floor second layer, need to have proper seam spacing on walls and ceilings

** distance of screws to edges of the ceiling and wall connection are too far apart, need to be within code compliance

** damaged sheet rock throughout on 2nd and 3rd floors on walls and ceilings

Go throughout both floors and correct all issues.

Not ready fee is issued and will need to be paid before next inspection

Comments: