CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRRES20192822

Address: 4068 NE CHAPEL MANOR DR, LEES SUMMIT, MO 64064

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

All Rough Inspection - Khanh Nguyen Failed Friday, January 31,

Residential 2020

Corrective Action Required:

1 Misc FRAMING:

- -Solid block between rafters along exterior wall where the separation distance from neighboring house walls is less than 12 ft; or provide 1 hr fire protection underneath soffit
- **Look at table IRC R302.1(1). When the roof soffit projection is less than ten ft from the adjacent house, then you either provide 1-hr fire protection on the underside of the roof soffit (no roof ventilation opening is allowed), or you solidblock between the rafters from wall top plates to the underside of the roof deck as allowed per note a.
- **Both sides of the house must comply with this table
- -Solid block underneath roof-support beam at foyer wall
- **About 3 ft left of the clothes washer drain pipe where the double studs supperting the lvl beam above, go down to the basement and soilidblock underneath the point load onto the I beam
- -Brace interior walls per plan
- **check later for screw gypsum board pattern

_			
Co	mm	าen	its: