

CITY OF LEE'S SUMMIT
Development Services Department
220 SE Green Street
Lee's Summit, MO 64063
(816)969-1200
DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRCOM20173051
Address: 1980 SE BLUE PKWY, LEES SUMMIT, MO 64063

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
Rated Assembly Inspection	Khanh Nguyen	Partial	Wednesday, March 18, 2020

Partial Correction:

1 ELEVATOR 1

ELEVATOR SHAFT:

1ST FL: Need to patch the wall above the restroom all the way to the steel beam. Screw pattern OK

2ND FL: elevator/mechanical shaft wall ok; east&west wall ok for 5/8" gb, north wall

3RD FL: elevator/mechanical shaft wall ok; east&west wall ok for 5/8" gb,north wall

ELEVATOR MECHANICAL SHAFT:

2ND FL: 1-hr lid ok;exterior walls,

3RD FL:exterior walls,

MID-BUILDING MECHANICAL SHAFT:

2ND FL: 1-hr lid ok,exterior walls,

3RD FL:exterior walls,

Corrective Action Required:

2 STAIR TOWER 1

The following areas:

1st Floor-OK to rock wall inside stair enclosure; outer side gb screw pattern OK

2nd-floor-OK to rock wall inside stair enclosure; outer side gb screw pattern OK

3rd-floor-Caulk the top edge of east wall inside stair enclosure; outer side gb screw pattern not extended to top edge (wall with door). Outer side screw pattern OK for other walls

***"STAIR TOWER 1" IS THE STAIR ENCLOSURE NEAR THE SE END OF BUILDING

Corrective Action Required:

3

STAIR TOWER 2

The following areas:

1st Floor-OK to rock wall inside stair enclosure; outer side gb screw pattern OK

2nd-floor-OK to rock wall inside stair enclosure; outer side gb screw pattern OK

3rd-floor-Caulk the top edge of north wall inside stair enclosure; outer side gb screw pattern OK

***"STAIR TOWER 1" IS THE STAIR ENCLOSURE AT THE NORTH END OF BUILDING

Comments: