## CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 **DEVSERVICES.CITYOFLS.NET**

## **Inspection Summary**

Permit #:PRRES20193664Address:1713 SW 27TH ST, LEES SUMMIT, MO 64082

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:		Inspector:	Outcome:	Date:
All Rough Inspection - Residential		Robb Popp	Failed	Wednesday, July 01, 2020
Corrective	Action Required:			
1 Miscellaneous ***DO NOT INSULATE*** Correction				
		ST CONNECTIONS AT DECK		
		-POSTS NOT TO BE NOTCHED FOR SIDE MEMBERS PER S3.0 AT DECK		
		-ANCHOR BOLTS TO BE IN MIDDLE 3RD OF PLATE-GARAGE		
		IN GARAGE		
		GARAGE		
		-FIRE BLOCK WEBS OF I BE	AMS IN ALL WALLS	
		-NAIL JOIST LAP CONNECTIONS OVER LAUNDRY		
		ECTIONS AND INTERMEDIAT	E WALL CONNECTIONS	
		PER CODE		
		-NAIL BOTTOM PLATE PER	BOTTOM PLATE PER CODE-MASTER CLOSET, MASTER BED DOORWAYS,	
		MASTER BED EXTERIOR WALLS		
		-ADD MISSING JOIST HAN	GERS IN KITCHEN	
		-SET NAILS IN JOIST HANG	OIST HANGERS IN KITCHEN	
		-PROVIDE ADDITIONAL ST	UDS TO CARRY POINT LOAD	IN OFFICE
		-MISSING (3) 2X4 IN MAST	ER BATH WALL	
		-SEAL FIREPLACE CHASE		
		-PROVIDE CLIPS AND THR	UST BLOCKS ON STAIRS PER	PLANS
		-TIGHTEN ANCHOR BOLTS	IN BASEMENT	
		-FIRE BLOCK FURDOWNS	AND WEB BEAMS IN BASEMI	ENT ALL LOCATIONS

-SEAL UPWARDS PENETRATIONS IN MECHANICAL ROOM

-FIRE BLOCK BEDROOM CHASE WLL BY WINDOW

-PROVIDE HORIZONTAL FIREBLOCKING MAX 10' IN FUROUT WALL

-EXPOSE FRAMING IN COVERED DECK FOR INSPECTION

-MISSING (2) 2X12 ON COVERED DECK

-MISSING (3) 2X6 IN PANTRY WALL

-WRONG SIZED STEEL COLUMN IN BEDROOM 3 WALL (TYPE E, 3 1/2" PER PLANS)

-PROVIDE MINIMUM (5) 2X4 SUPPORTING BEAM IN BEDROOM 3 PER PLANS -PROVIDE SOLID BLOCKING OF JOISTS PARALLEL TO FOUNDATION WALL PER DETAIL ON \$2.0

-INSULATE AND PROVIDE BLOCKING ABOVE WALL AT CANTILEVERS

## Comments: