CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRRES20201232

Address: 1512 SW GEORGETOWN DR, LEES SUMMIT, MO 64082

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

All Rough Inspection - Patrick Schonfeldt Failed Friday, September 18,

Residential 2020

Corrective Action Required:

1 Misc - H2.5 strap missing - garage

- Garage PFH per plans
 structural straps required at all top plates bored 50% or more at all exterior
- walls and interior load bearing walls
 Protection plate at DWV kitchen window bottom
- Joist hanger required at joist connection to beam living room side at stairwell
- Protection plate at refrigerator pex bottom plate
- Security blocking at front, back door
- Joist hangers required at all floor joist (4' or more) connected to dbl lvl above back door in kitchen
- Support DWV ever 48" o.c.
- Incomplete DWV at chase in living room
- (2) 3" SCH 40 steel columns missing at W13x19 steel beam as shown in plans, beam supported at E end by steel column
- EC#2 per plans
- Connect 2x6 to 2x4 top plates at 2nd floor stairs
- Protection plate at top and bottom plate DWV master bath
- Protection plate at bottom radon master closet
- H2.5 straps missing back porch
- Nail off all truss hangers

- Truss hangers per plans
- Joist hangers required at header above HVAC basement
- Anchor all columns to floor
- Header with joist hangers required at connections for cut dbl floor joists for \mbox{HVAC} \mbox{W} side basement
- Gas line incomplete
- Joist hangers required at cantilever header and joists in basement
- Joist hangers required at basement to floor landing floor joists and dbl joist header

Comments: