CITY OF LEE'S SUMMIT

Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRRES20202145

Address: 1862 NE PARK RIDGE DR, LEES SUMMIT, MO 64064

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

All Rough Inspection - Khanh Nguyen Failed Friday, October 30,

Residential 2020

Corrective Action Required:

1 Misc FRAMING:

- -Install flashings above exterior wall trims
- -Nail garage portal brace wall sheathing per code; install straps
- -Anchor sill plate within 12" of break, min 2 per plate
- -Remove all osb sheathing debris from roof
- -Fb laundry/garage wall from ceiling/roof space
- -Provide full width bearing support for I beam at kitchen & dining
- -Support IvI hip above rear dining
- -Brace ends of IvI beams against rotation
- -Support hip rafters above entry door
- -Provide full support for beam above foyer hallway
- -Nail corner studs with 16d @12" oc or equivalent nailing
- -Fb triangular space at front dining; fb fireplace space from roof; fb all dead spaces from roof throughout
- -Install collar ties near ridge
- -Support hip rafters above front bedroom
- -Nail siding into studs at rear bedroom&bathroom roof step flashings.
- -The upset IvI beam above bedroom #3 must extend to IvI across the catwalk
- -Provide (2) IvI beam above doorway to front dining; provide support

underneath point loaf

ELECTRICAL:

- -Protect wiring within 6 ft of all attic access openings
- -Install dryer receptacle box
- -Protect SE cable at bottom wall plate; protect other wirings at bottom wall plate throughout
- -Provide a wall receptacle at foyer wall (with switch) wider than 3 ft
- -Provide minimum 12"x12" clear unobstructed opening for access to hydro tub motor. Receptacle cannot obstruct opening

MECHANICAL:

- -Vent 2nd fl bath fan
- -Provide insulation shield for 2nd fl furnace b-vent

**OK TO INSULATE

Comments: