CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRPWFR20161876

Address:

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

Erosion Sediment Control (ESC) Joe Starlin Failed Monday, January 11,

Inspection 2021

Corrective Action Required:

1 PW-Devices for Matt Munger 02/08/2018 2:52 PM There are problems with the erosion control devices on your site.

Erosion and control devices on your site.
Sediment Control

1530 SW Blackstone PL. has silt fence down on the SW Napa Valley Dr. side as well as corrugated pipe laying on top of the silt fence behind that address.

ESC needs to be intact on all lots that have not had vegetation established to ensure silt does not leave the site. ESC devices used in curb inlets need to

maintained periodically to ensure they are working properly.

Corrective Action Required:

PW-Devices for Matt Munger 02/14/2018 10:42 AM

Erosion and ESC needs to be intact and maintained to be in compliance. There is a home Sediment Control on the corner of SW Blackstone Pl and Napa Valley Dr that the silt fence is

down. Behind that home the silt fence has storm pipe laying over the fence.

Failure to maintain ESC can result in a Stop Work Order.

Corrective Action Required:

PW-Devices for Matt Munger 02/20/2018 1:38 PM

Erosion and The swale that runs between the houses off SW Napa Valley Dr. and SW Sediment Control Blackstone Pl is holding water. Run off from the swale is running over into

the backyard of 1709 SW Napa Valley Dr. and other backyards off SW Napa

Valley Dr that back up to the swale.

The gutter devices off of SW Napa Valley Dr. going into the 3rd Plat is not draining properly. The silt fence has been breached as well up from the curb inlets. ESC needs to be in place and maintained to be in compliance.

Corrective Action Required:

4 PW-Devices for Erosion and

Matt Munger 02/26/2018 12:30 PM

ESC is not in compliance on several lots along Blackstone Pl in the 3rd plat.

The gutter device in the curb inlet off Napa Valley Dr. needs to be

maintained.

Corrective Action Required:

5 PW-Devices for Erosion and

Matt Munger 03/05/2018 3:13 PM

The silt fence that runs between the 1st plat and the 3rd plat has not been repaired since the concerned home owner called in about the issues it has

caused to their yard.

Corrective Action Required:

6 PW-Devices for

Matt Munger 03/20/2018 1:01 PM

Erosion and Sediment Control

Sediment Control

Sediment Control

There are several gutter devices that need to be cleaned and maintained to prevent silt from entering into the storm drain. Due to the lack of ESC on building sites silt is building up in the gutter devices making them less

effective.

Corrective Action Required:

7 PW-Devices for

Matt Munger 03/27/2018 10:51 AM

Erosion and
Sediment Control

Sediment Control

The soil below silt fence at the bottom of the swale off of SW Napa Valley Dr. has washed out allowing silt to get past the silt fence. The silt fence will need to be repaired to prevent silt from entering into the curb inlet directly

below it.

Corrective Action Required:

8 PW-Devices for Erosion and

Matt Munger 04/09/2018 10:05 AM

The silt fence on at the bottom of the swale off of Napa Valley Dr. has had a blow out and will need to be secured properly. I have sent prior emails to Kevin about correcting ESC issues for both Napa 2nd & 3rd with little response. It did appear that he cleaned up the gutter devices that had silt

built up in them.

Informational:

9 Misc 1-11-21 There is silt making its way out of the detention basin and into the

creek. There are gutter buddy's missing and the ones that are in place are full or damaged and need replaced. Blackstone has excessive debris on the road

that needs addressed. These corrections need addressed ASAP.

Comments: