CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRRES20202913

Address: 132 NW MACKENZIE DR, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

All Rough Inspection - Robb Popp Failed Wednesday, June 09,

Residential 2021

Corrective Action Required:

1 Misc -Complete exterior nailing pattern

- -Address columns not fully bearing on concrete at back deck
- -Provide (2) 1/2" bolts at all post to beam connection at deck
- -Uncover trusses and connections at deck
- -Fb vent at soffit line in garage
- -FB hvac chase at soffit line to prevent vertical to horizontal fire spread in garage
- -Strap top plate at south garage wall lapped less than 24" garage
- -Nail all corner studs 12" oc
- -Strap all dwv 2" and smaller at midpoint
- -Install roof boots throughout
- -Nail guard at nm by back door
- -Address no bearing at double girder truss above stairs
- -Bocca plate at pex in entry
- -3 studs required at exterior corners at master bath
- -Lower bocca plates to provide 2" of protection at master bath
- -Address trusses nailed to plywood at master bed and hallway
- -missing nails in hanger master bed
- -Strap top plates at master bed/great room
- -Strap top plate bored greater than 50% at master bath and upstairs bath $\,$

south wall

- -3 studs in corners by basement kitchen
- -vertical FB basement kitchen 10' oc maxm
- -Anchor bolt end of plate each side basement doors
- -tighten anchor bolts in basement
- -Vertical FB basement north wall 10' oc max
- -Address over bored and over notched studs by electrical panel
- -top plate over notched for gas line north wall

Comments: