CITY OF LEE'S SUMMIT

Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRRES20204977

Address: 202 NW AMBERSHAM DR, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

All Rough Inspection - Michael Harkins Failed Thursday, August 26,

Residential 2021

Corrective Action Required:

1 Miscellaneous Wsp throughout

Correction Unable to verify nailing pattern

Basement

- -Fireblock soffit lines and gaps in soffit FB
- -Fireblock beam webs
- -Secure steel posts
- -Fireblock stud penetrations in horizontal FB at furout walls
- -Connect bath fan vents Jack and Jill
- -Bocca plate at bottom plate J&J bath
- -Midpoint strap 2" and smaller dwv
- -Seal penetrations in joist space at return air and pan off in soffit at office/bath
- -Furout top plate at soffit office and rec room
- -Address garage/ dwelling separation at stairs
- -Joist hanger by stairs
- -Bond gas line before first ward flex connection

Provide anchor bolt within 12" of plate break garage

Tighten 5/8'anchor bolt portal frame garage

Seal upward penetrations garage Seal all low volt penetrations

Seal upward penetration DWV rear garage / master bath

Tighten anchor bolts rear garage
Provide roof boots VTR
Solid block sheathing breaks @ foyer and nail per code
Set nails in hanger box ceiling foyer
Provide boca plate at cleanout near basement door
Nail joist hanger in storage room basement

Comments: