CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 **DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #:PRRES20211351Address:4072 NE TIMBERLAKE CT, LEES SUMMIT, MO 64064

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
All Rough Inspection - Residential	Khanh Nguyen	Failed	Wednesday, November 03, 2021
Corrective Action Required:			
1 Misc	 -Install 2 lag screws at deck beam to post connections -Fb all wall plates penetrations -Seal all penetrations of return air space -Brace ends of roof beam from rotation -Install collar ties per code -Fasten fireplace to framing -Fb the side and back wall of the fireplace space -Provide insulation shield for the fireplace flue -Support rear porch hip rafters at ridge -Reinforce the notched ceiling joist above middle living room window. Don't header off -Security blocking for deck door -Seal gap at top of the return air space at laundry/living room wall -Support vent piping above pantry/mud/laundry -Protect wiring within six ft of attic access -Window located within 24" of master bedroom deck door must be tempered glass window -Fb stair wall from I beam soffit -Install joist hangers above stair -Fb basement wall vertically at ten ft or less interval; fb wall from bathroom fur down ceiling space; fb front basement bedroom wall from fur down 		

ceiling space

-Anchor basement sill plates within 12" of breaks. Min 2 anchors per short plate

-Install missing studs at rear color basement

-Connect the gas piping bonding conductor to the equipment grounding bus bar

-Have engineer address support of the 16" lvl at front fireplace wall

**OK TO INSULATE

Comments: