CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #:PRRES20211547Address:3073 NW THOREAU LN, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:		Inspector:	Outcome:	Date:	
All Rough Inspection - Residential		Mark Harding	Failed	Thursday, December 16, 2021	
Informatio	onal:				
1	Miscellaneous	7-27-21 Portal Frame Inspection: OK to cover exterior at PFH			
	Correction				
		*rear covered patio truss ok. front ok			
Corrective	Action Required:				
2	Misc	-Fire stop 3" dwv at front office rear wall , at ceiling height.			
		-Missing truss hanger nails over door into front office			
	-terminate Romex north office exterior wall -Fire stop hole through top plate left of dryer vent.				
		- nail Dbl truss over stairs as loft.			
		- support dwv 48" O.c. basement, mstr shower.			
	-Aluminum bonding clamp on steel gas line with copper ground base north wall.			r ground basement	
-support ducts in basement 10'o.c. (Office)					
		-fire stop tub traps 1st floo	op tub traps 1st floor south over kitchen .		
		fire stop flue chase 1st floor from joist space . See front ot 1/2 bath.			
- fire stop heat chase to jo			st space , see left side of clo	set 1st floor.	
		 provide eng fix on truss over garage supported by blocking. 			

- Address vent penetration through roof at laundry

- Nail off hangers in laundry
- Install can light in hall by laundry
- Nail truss hangers office
- Nail truss hanger A5 upstairs front bedroom
- Nail truss hanger B6, D1, B17 upstairs loft and back bedroom
- Provide corrections for cut joist in basement behind furnace at dwv
- Block out cantilever in basement
- Nail joist hanger basement above bottom riser
- Basement column C should be 3 1/2" not 3"
- Install TJC37 at CJ14 per plan

Comments: