# CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

# **DEVSERVICES.CITYOFLS.NET**

# **Inspection Summary**

Permit #: PRRES20214054

Address: 4716 NE FREEHOLD DR, LEES SUMMIT, MO 64064

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

All Rough Inspection - Khanh Nguyen Not Ready Tuesday, February 22,

Residential 2022

## Corrective Action Required:

1 Misc -Support 3" drain in garage soffit at max 4 ft

- -Provide triple ceiling beam above master bedroom per plan. This beam is supposed to carry roof load, not the master bedroom/closet wall, which is not a bearing wall.
- -Plan calls for double 11-7/8" LVL beam at rear great room wall. Currently triple 2x10 installed. Have engineer verify beam size
- -Install deck door per security code. Shim gap at strike plate side and security block at strike plate height
- -At 2nd fl bathroom, staple wiring min 1.25" away from stud nailing surface \*\*bedroom 3/bathroom wall
- -Install triple 2x10 at basement per plan (under master closet). Provide full support at exterior wall end
- -Fb gaps at vertical fire blockings. Use 3/4" sheathing for fire blocking; vertical fire blockings must be no more than ten ft apart, including wall space above windows.

- \*\*fb gaps at vertical fire blockings. Use 3/4" sheathing or other approved material
- -Security blocking for basement walkout door at strike plate height; fill in gap at hinges and strike plate side with solid wood per security code
- -Fb basement bedroom 4 wall from closet soffit
- \*\*pack insulation in gap
- -Protect water line at bedroom 4 closet wall top plate
- \*\*not done
- \*\*OK TO INSULATE
- \*\*2/9/22-THIS IS A 2ND FAILED INSPECTION
- \*\*2/16/22-REINSPECTION FEE ASSESSED
- \*\*2/22/22-REINSPECTION FEE ASSESSED

## **Comments:**