

CITY OF LEE'S SUMMIT  
Development Services Department  
220 SE Green Street  
Lee's Summit, MO 64063  
(816)969-1200  
**DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #: PRRES20215180  
Address: 2020 SW WHEATFIELD CT, LEES SUMMIT, MO 64082

---

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
<b>All Rough Inspection - Residential</b>	Mitchell Schwarz	Failed	Friday, April 01, 2022

Corrective Action Required:

2	Misc	-uncover front patio to inspect framing -collar ties 4' OC (garage) -PFH strapping per plans -nail all intersecting wall corners 12" OC -seal top plate penetration left of garage entry -complete bath fan exhaust (entry bath) -seal bottom plate penetrations garage entry bath -stud packs per plans under lvl entry bath N wall -provide plumbing in prep kitchen for sink -fire block furr down in prep kitchen -fire block pantry wall to ceiling space behind furr down. Seal gaps -complete furr down for dwv and plumbing above kitchen -lvl header above sliding read door per plans -un cover covered patio for inspection -address header/beam connection right of slider s3.2 10 -address rear great room windows not framed to plans -seal floor penetration for cables at fireplace -seal gap for fireplace wall into furr down -missing joist hanger above master suite hall entrance also hanger missing nails -seal open end into furr down in master suite SW corner
---	------	---

- seal bottom plate penetration master bath NE corner
- address front door framing not to plans
- Stud pack at 2nd floor supporting lvl plans call for 8studs
- Protect Nm within 6' of attic access 2nd floor
- fire block basement stairwell wall to ceiling space
- steel columns in basement to be of correct size
- seal penetration in return air panning in basement
- install all windows
- provide pressure gauge at gas line for inspection
- bond gas line before first csst connection
- anchor bolts within 6" of sill plate break E basement wall
- address piers poured without inspection

**Comments:**