CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRRES20214616

Address: 1825 SW SAGE CANYON RD, LEES SUMMIT, MO 64082

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

All Rough Inspection - Patrick Schonfeldt Failed Thursday, April 07,

Residential 2022

Corrective Action Required:

1 Misc -Nail exterior sheathing garage portal PFH per plans

-PFH portal bracing design at single car garage per plans

-unable to inspect covered deck roof framing with lid installed

-nail all exterior sheathing per plans

-fur down HVAC garage ceiling to allow for insulation

-fireblock HVAC chase garage

-solid block between joists above beam lateral restraint

-provide lateral restraint ceiling joists sgl car bay garage

-provide anchor bolt within 12" of plate break garage portal

-fireblock between studs, vertical to horizontal at furred down soffit line

between sgl and dbl garage doors at garage wall -provide flashing boots all roof penetrations

-seal all penetrations through air returns, check ceiling joist penetrations as

well

-support DWV every 48" oc

-provide protection plate bottom plate pex kitchen

-provide stud shoe exterior studs bored for DWV kitchen wall

-provide nail protection plates all NM 1 1/4" or less from end of stud

throughout

-complete gas line install at fireplace

-protect CSST line at fireplace casing entry

- -have engineer address rafters landing on multiple blocks throughout, rafters not connected to ceiling joists, rafter ties
- -solid block all sheathing breaks
- -CS-PF portal bracing at great room and front entry wall, master bedroom per plans, detail A4
- -seal top plate penetrations master bed
- -fireblock between furring strips stair/master bed wall 2nd floor
- -Minimum 24" offset between plate breaks dbl top plate see laundry, bedroom 4
- -Interior wall bracing per plans, will need to reinspect screw pattern for GB bracing after rock release

Comments: