

April 22, 2022

Summit Homes 120 SE 30th St. Lee's Summit, MO 64082

RE: Field Issue of over bored stud in garage for Lot #153 Hawthorne Ridge – 3204 SW Arboridge Dr. Lee's Summit, MO 64082 – Permit # PRRES20213383

This letter addresses the over bored hole in stud at garage exterior wall.

- Stud is overbored at electrical panel box in garage.
- Wall has approx. 2' tributary width of roof loads for 90 plf.
- Hole is approx. 2.5" diameter.
- Electrical line diameter is approx. 1.5".

Recommended modifications:

• Install Simpson SS1.5 stud shoe per manufacturer's specifiactions.

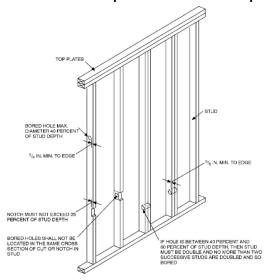


FIGURE R602.6(1)NOTCHING AND BORED HOLE LIMITATIONS FOR EXTERIOR WALLS AND BEARING WALLS

Many of these products are approved for installation with Strong-Drive® SD Connector screws.

Model No.	Stud Size	W (in.)	Fasteners (in.)	Allowable Loads ¹ DF/SP Compression							
										Floor (100)	Roof (125)
						SS1.5	2x	1%6	(12) 0.148 x 1½	500	500
SS2.5	Зх	2%6	(12) 0.148 x 11/2	730	740						
SS3	(2) 2x	31/16	(12) 0.148 x 3	730	830						
SS4.5	(3) 2x	4%6	(14) 0.148 x 3	840	840						

Sincerely,

Bradley Huxol, PE

BRADLEY
HUXOL
NUMBER
PE-2011000903