CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 **DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #:PRRES20212466Address:508 SE DAVID RD, LEES SUMMIT, MO 64082

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:		Inspector:	Outcome:	Date:
All Rough Inspection - Residential		Robb Popp	Failed	Wednesday, May 11, 2022
	e Action Required: Misc	HOUSE NOT READY. ADDRESS ALL ITEMS BEFORE RE INSPECTION. HAVE ENGINEER ADDRESS FRAMING ISSUES WITH ENGINEER BEFORE REINSPECTION - Tighten all anchor bolts - Remove insulation from wall and ceiling joists - Pan off fur out and hvac chase with approved materials - Overnotched hip joist at entry/ garage beam - Address ceiling joist, hip, rafter and beam taper cuts and overnotched rafters throughout - Fireblock gap sheathing to roof space at garage return wall - Address end rafter not bearing on 1.5" at glue lam - Support hip above glue lam - Support hips in double car bay - not easily visible due to plywood but visibly		
		not supported	at double car header both si ngle car bay nanical in garage n in laundry ceiling joists in kitchen	

Comments: