

CITY OF LEE'S SUMMIT  
Development Services Department  
220 SE Green Street  
Lee's Summit, MO 64063  
(816)969-1200  
**DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #: PRCOM20202637  
Address: 1001 SE BAILEY RD, LEES SUMMIT, MO 64081

---

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
<b>Rated Assembly Inspection</b>	Robb Popp	Failed	Friday, May 13, 2022

Informational:

1	FIRST FLOOR	<b>**AREAS APPROVED**</b>  -SHAFT LAYER AT BUILDING A/B SEPARATION WALL BOTH SIDES -SCREW PATTERN AND FIRE TAPE SHAFT WALL BUILDING A -SHAFT LAYER AT BUILDING C/D SEPARATION WALL -SCREW PATTERN AT SHAFT WALL BUILDING C -SHAFT LAYER AND SCREW PATTERN AT SECOND LAYER ELEVATOR BUILDING B -SHAFT CEILING RATING AT A11, A14, -SCREW PATTERN 2ND LAYER C113,C111,C111A -SHAFT LAYER AT ELEVATOR IN B- SEAL GAPS AND PENETRATIONS ON INSIDE. OK FOR SECOND LAYER - 1/27/22 SCREW PATTERN 1ST LEVEL 1ST LAYER TYPE X FACE AT DOORS -
---	-------------	---

Corrective Action Required:

2	Miscellaneous Correction	<b>**5/6-First floor inspection of rated assy:</b> -Seal penetration at A/B vestibule. A/B firewall not fully inspected. -West C/D fire vestibule-firecaulk top of wall. -Middle C/D fire vestibule-OK to complete the rated ceiling assy. Leave access opening open to inspect penetrations of the firewall -East C/D fire vestibule-OK to complete the rated fire assy
---	-----------------------------	---

\*\*\*\*\*5/18/22- alternate firestopping material not approved for use in

through penetrations, remove and replace with approved material.

**Corrective Action Required:**

3

SECOND FLOOR

- SHAFT WALL LAYER AT BUILDING A
- BETWEEN FLOOR SEPARATION AT BUILDING A/B SHAFT WALLS
- SHAFT LAYER AT MECHANICAL/ PLUMBING CHASES ROOMS A218,A214,
- SHAFT CEILING RATING AT A26, A25
- SHAFT LAYER AT CHASE B211, ,C213, C209
- SHAFT WALL BETWEEN C&D-SCREW PATTERN OK
- SHAFT LAYER AT ELEVATOR IN B- SEAL GAPS AND PENETRATIONS ON INSIDE.  
OK FOR SECOND LAYER
- 1/27/22 2ND LEVEL SCREW PATTERN 1ST LAYER TYPE X FACE AT DOORS -
  
- 4/21/22- Seal all through penetrations at vestibules and elevator, provide  
documentation on fire stopping products

**Comments:**