CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 **DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #:PRRES20216043Address:1617 SW 27TH ST, LEES SUMMIT, MO 64082

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspector:	Outcome:	Date:
Robb Popp	Failed	Thursday, July 07, 2022
-header to top plate connection per design at garage portal frame-PROVIDE 2 ROWS 16d SINKERS 3" OC -rear dining room windows framed to cspf per plans and design-CSPF REQUIRES MIN (3) 11 1/4" HEADER AND EXTERIOR NAILING PATTERN- SEE G4 DETAILS -address notched triple IvI at hanger see great room / foyer (provide engineering for fix)-NO ENGINEERED CORRECTION ON FILE -seal return air at master entry hall-SEE BATHROOM STUD CAVITIES -address holes border too close to each other above master bath-NOT DONE		
	Robb Popp -header to top plate con ROWS 16d SINKERS 3" OF -rear dining room windo REQUIRES MIN (3) 11 1/4 DETAILS -address notched triple engineering for fix)-NO -seal return air at maste -address holes border to -seal penetrations in joi	Robb PoppFailed-header to top plate connection per design at garageROWS 16d SINKERS 3" OC-rear dining room windows framed to cspf per plansREQUIRES MIN (3) 11 1/4" HEADER AND EXTERIOR NADETAILS-address notched triple IvI at hanger see great roomengineering for fix)-NO ENGINEERED CORRECTION C-seal return air at master entry hall-SEE BATHROOM

Comments: