CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRCOM20210263

Address: 1801 NW OBRIEN RD, LEES SUMMIT, MO 64081520 NW HOPE LN, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

All Rough Inspection - Robb Popp Partial Thursday, July 21, 2022

Commercial

Corrective Action Required:

Corrective Action Required:

1 Miscellaneous -Provide fire collars at 2008,3008,4008,5008

Correction

2 SECOND FLOOR : THE FOLLOWING AREAS ARE APPROVED :

- 2ND FLOOR AREA A

- UNITS 2021,2022,2023,2024,2025,2027,2029,2004,2005,2006

**2008-Provide fire collars at dwv in chase

2001- seal dead spaces, strap at top plates both sides, complete mechanical,

fireblock ceiling line at existing tie in, doorway,

Corrective Action Required:

THIRD FLOOR: THE FOLLOWING AREAS ARE APPROVED:

:: 3ND FLOOR AREA A:

3004,3005,3006,3021,3022,2023,3024,3025,3027, 3029

2001- seal dead spaces, strap at top plates both sides, complete mechanical,

fireblock ceiling line at existing tie in, doorway,

3001- fireblocking, complete framing, H2.5s at exterior walls. Strap top plate

:::AREA B-

3035- complete bath exhaust, midpoint strap dwv in bath, complete

mechanical in back bed

3030-complete bath exhaust and mechanical in back bed

3033-ok 3028-ok

3031-Address truss bored above island

3026-ok

3011-address ledger connections at elevator,

Corrective Action Required:

4 FOURTH FLOOR

THE FOLLOWING AREAS ARE APPROVED

::AREA A:

4004-4006,4021-4025,4027,4029

2001- seal dead spaces, strap at top plates both sides, complete mechanical,

fireblock ceiling line at existing tie in, doorway,

4001 - Fireblocking, strap top plate at stairwell

AREA "B"

4011-FIREBLOCK DEAD SPACES

4035-OK 4030-OK 4033 OK 4028-OK

4031-address main lugs at panel, joist hangers at deck tension tie joist

4026-OK

Corrective Action Required:

5 FIFTH FLOOR

AREA "A"

THE FOLLOWING AREAS ARE APPROVED:

5004-5006,5021-5025,5027,5029

5001-strap top plates, fireblocking throughout

AREA "B"

-5035-OK

-5030-OK

5033-OK

5028-OK

5031-OK

5026-OK

Comments: