

CITY OF LEE'S SUMMIT
Development Services Department
220 SE Green Street
Lee's Summit, MO 64063
(816)969-1200
DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRCOM20210263

Address: 1801 NW OBRIEN RD, LEES SUMMIT, MO 64081520 NW HOPE LN, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
All Rough Inspection - Commercial	Robb Popp	Partial	Friday, August 19, 2022

Corrective Action Required:

1	Miscellaneous Correction	Stairwells
---	--------------------------	------------

Stair 3- Address fire rating not extended to roof deck, repair shaft wall at 4th landing, h2.5s at hip trusses
Stair 2- Address fire rating not extended to roof deck, complete stairs at 2-1
Stair 1-OK

Corrective Action Required:

2	SECOND FLOOR	: THE FOLLOWING AREAS ARE APPROVED :
---	--------------	--------------------------------------

- 2ND FLOOR AREA A
- UNITS 2021,2022,2023,2024,2025,2027,2029,2004,2005,2006
-2002 ACTIVITIES - OK

2001- seal gaps dead spaces, fireblock ceiling line at existing tie in doorway

AREA B:

2011-OK
2015,2016,2019-OK

2026-seal conduit penetration in bed 2 closet, complete fur out and

fireblocking at storm in bed 1,
2031-OK
2028-OK
2033-OK
2030- -OK
2035-OK

2001-INSTALL MISSING FIRE DAMPERS

Corrective Action Required:
3 THIRD FLOOR

: THE FOLLOWING AREAS ARE APPROVED :

:: 3ND FLOOR AREA A :
3004,3005,3006,3021,3022,2023,3024,3025,3027, 302

3001- Seal gaps in fireblocking

:::AREA B-
3035- complete bath exhaust, midpoint strap dwv in bath, complete
mechanical in back bed
3030-complete bath exhaust and mechanical in back bed
3033-ok
3028-ok
3031-OK
3026-ok
3011-address ledger connections at elevator,
3001- INSTALL MISSING FIRE DAMPERS

Corrective Action Required:
4 FOURTH FLOOR

THE FOLLOWING AREAS ARE APPROVED

:::AREA A:
4004-4006,4021-4025,4027,402,
4001 - Seal gaps in Fireblocking

AREA "B"
4011-OK
4035-OK
4030-OK
4033 OK
4028-OK
4031-address main lugs at panel, joist hangers at deck tension tie joist
4026-OK
4001-INSTALL MISSING FIRE DAMPERS

Corrective Action Required:
5 FIFTH FLOOR

AREA "A"
THE FOLLOWING AREAS ARE APPROVED:
5004-5006,5021-5025,5027,5029

5001-INSTALL MISSING FIRE DAMPERS

AREA "B"

-5035-OK

-5030-OK

5033-OK

5028-OK

5031-OK

5026-OK

Comments: