

October 12, 2022

Summit Homes 120 SE 30th St. Lee's Summit, MO 64082

- RE: Field Issue of over notched joist for Lot # 156 Woodside Ridge 365 NW Patch Ct Lee's Summit, MO 64081 Permit # PRRES20222875
 - 1. Over notched floor joist in garage:
 - Floor joist was notched on the side $\frac{1}{2}$ " to accommodate plumbing for the depth (9.25") of the 2x10



SIMPLE SPAN

- D1 9.25"
- D2 4''
- Length 1 9"
- Length 2 14' 8"
- Span 15' 9"
- Support #1 Rear LBW at garage
- Support #2 Garage W12 X 22 STL beam
- Location Garage, under bath #2
- Loading -

• Dead = 15 psf @ 16" oc

• Live = 40 psf @ 16" oc

Recommended modifications:

Sister a 6' length DFL #2 2x10 flush with rear garage load bearing wall. Attach with glue and
(4) 3" Simpson SDS screws per linear ft. in a "w" pattern.

Sincerely,

Bradley Huxol, PE

