CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRRES20223080 Address: 4408 SW GRINDSTONE CIR, LEES SUMMIT, MO 64082

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

| Inspection: | | Inspector: | Outcome: | Date: | |
|---------------------------------------|---|---|--|-----------------------------|--|
| All Rough Inspection - Residential | | Michael Harkins | Failed | Friday, October 21, 2022 | |
| Corrective | Action Required: | | | | |
| 1 | Miscellaneous | No pier inspection on record | | | |
| | Correction | Nail joist hangers at cantilever basement Provide 1" clearance to b vent at furnace low volt | | | |
| | | | | | |
| | | Nail side by side studs at front door corner | | | |
| | | 16" OC stud spacing exterior wall at above | | | |
| | | Joist hangers missing nails LVL foyer/ dining room | | | |
| | | Fire block DWV/ HVAC @ plumbing chase breakfast | | | |
| | | Install missing windows | | | |
| | | Nail exterior wall sheath | iing per code | | |
| | | Provide 2 nails top & bo | Provide 2 nails top & bottom plates and intersecting studs at LIBs Fire block DWV at soffit in dead space near refrigerator | | |
| | | Fire block DWV at soffit | | | |
| | | Seal upward penetration dining room/ garage | | | |
| | | Tighten anchor bolts garage | | | |
| | Provide 3" SCH 40 column garage beam per plan | | | | |
| | | Provide attic access garage per plan | | | |
| | | Nail stud to stud and ab | ail stud to stud and abutting studs at intersecting wall corners (at braced wall anels) per plan | | |
| | | panels) per plan | | | |
| | Provide 4 stud pack at GT bearing points per plan Solid block & nail exterior wall sheathing WAP per code co | | | | |
| | | | de corner bed 3 | | |
| | | Seal upward penetration bed 4 / closet | | | |
| | | Seal upward penetrations HVAC chase laundry | | | |

GT bearing point master water closet per plan Missing H2.5 or trusslok back patio & garage

Comments: