## CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 **DEVSERVICES.CITYOFLS.NET**

## **Inspection Summary**

Permit #: PRRES20213806 Address: 3809 SW MARYVILLE PL, LEES SUMMIT, MO 64082

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:		Inspector:	Outcome:	Date:
All Rough Inspection - Residential		Patrick Schonfeldt	Failed	Friday, November 04, 2022
Corrective	e Action Required:			
-fireblock at top plate betw -no top plate corner lap co -unable to see truss hange -provide engineer letter fr trusses and gusset plates f truss engineer address tru sheared down at wall line -provide nail protection pl stud-see foyer, great room -min 6'8" head clearance re -install patio door at baser -provide protection gromn protect NM -toenail all floor joists per -cap and label future vent		master bath cut short of headers throughout ween furring strips at stairwall onnection at front entry exterior wall er and hold downs at rear deck with lid installed rom truss manufacturer on solutions for damaged from submitted letter from everstead, also have isses at great room that have had chords and plates lates at NM that is within 1 1/4" or less from end of n required at basement stairs ment met at conduit sleeve for sump pump basement to code at basement bists every 48" at kitchen island, extend blocking le of island per plans		

-provide clamp for GEC at UFER rated for dissimilar metal separation of rebar, (acorn style clamp is for copper conductor to copper ground rod)
-check gauge used for gas pressure test, no movement of needle at pressure test with air loss

**Comments:**