CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRCOM20210263

Address: 1801 NW OBRIEN RD, LEES SUMMIT, MO 64081520 NW HOPE LN, LEES SUMMIT, MO 64081

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Outcome: Date:

Above Ceiling Inspection Robb Popp Partial Wednesday,

November 16, 2022

Corrective Action Required:

1 Misc HARD LIDS

*REMOVE PUTTY PACKS AND FIRECAULK ALL PENETRATIONS IN RATED

ASSEMBLIES

*SECURE ALL MC AND LOW VOLTAGE OFF OF GRID

*PROVIDE COVERS AT J BOXES AND KNOCKOUT COVERS AT UNUSED

KNOCKOUTS

Corrective Action Required:

2 SECOND FLOOR AREA "A"

Room 2004 pass

Corridor 2007 soffits penetrations missing fire box missing above fire door

Room 2006 pass Room 2008 ok Room 2010 ok

Room 2005 access panels

2002-access panels for dampers

2017 soffits ok 2015,2019 ok 2007 to fire wall

Corrective Action Required:

3 THIRD FLOOR AREA "A"

3004 pass 3005 pass 3006 pass 3008 ok 3010 ok 3017 sofffits ok 3007 to fire wall

Corrective Action Required:

FOURTH FLOOR

AREA "A"

4004-ok

4005-access panels

4008-ok 4010-ok 4006-OK

Corridor 417 soffits ok Corridor 4007 to fire wall ok

4017-missing cover plate at fire wall, remove putty packs

Corrective Action Required:

FIFTH FLOOR

AREA "A"

5004 seal upward penetrations, provide cover open box

5006-ok 5008 ok 5010-ok

Corridor 5007 soffit at fire door ok to cover

5013 ok 5007-ok 5001-ok

5005-access panels 5004-dampers 5006-OK

corridor 5007 to firewall ok

5017-seal penetrations at elevator in lobby

ALL SOFFIT FRAMING IN CORRIDORS BUILDING B OK

Comments: