# CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

# **DEVSERVICES.CITYOFLS.NET**

# **Inspection Summary**

Permit #: PRRES20231716

Address: 2012 SW HOLDBROOKS DR, LEES SUMMIT, MO 640822014 SW HOLDBROOKS DR, LEES SUMMIT,

MO 640822016 SW HOLDBROOKS DR, LEES SUMMIT, MO 640822018 SW HOLDBROOKS

DR, LEES SUMMIT, MO 64082

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

Occupancy Inspection - Codes Kyle Beard Failed Friday, December 01,

Residential 2023

Corrective Action Required:

1 Miscellaneous 2018 occupancy

Correction Exterior of house was not inspected

2016

electrical box under sink needs to be secured Microwave plug in has a gap behind the plate Gas line rubs against a/c line in the basement

Seal penetration above the garage interior overhead door

Exterior of house was not inspected

2014

First to second riser height going up from the entrance platform has a difference of 3/4 of an inch. IRC allows 3/8 difference
Stairwell wall clearance from entry platform to living/kitchen is 35 3/4 inches wide. IRC requires a minimum clearance of head room at 36 inches
Upper stairs at kitchen/living rooms to bedroom first to second riser has a height difference of 1/2 inch. IRC allows 3/8 maximum height difference
Under stair to sump pump needs to be fire blocked (panel is missing)
Seal all ceiling penetrations in garage

Garage door to house is missing it's weather seal Exterior of house was not inspected

### 2012

stove anti tip bracket is not working Garage to house stairs are not installed Seal all interior garage ceiling penetration Exterior of house was not inspected

# Corrective Action Required:

2 Miscellaneous

2018

Correction

Exterior of house was not ready for inspection Inside of house passed for TCO only

### 2016

Exterior of house was not ready for inspection Inside of house passed for TCO only

# 2014

- -First to second riser height going up from the entrance platform has a difference of 3/4 of an inch. IRC allows 3/8 of an inch difference
- -Upper stairs at kitchen/living room to be drooms, first to second riser has a height difference of 1/2 inch. IRC allows 3/8 maximum height difference
- -Exterior of house was not ready for inspection

### 2012

- -Garage to house door will not fully close with the self closing hinge
- -Exterior of house was not ready for inspection

TCO passed on 2016 and 2018 only. This is a partial pass only

## **Comments:**