

CITY OF LEE'S SUMMIT
Development Services Department
220 SE Green Street
Lee's Summit, MO 64063
(816)969-1200
DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRRES20236052
Address: 3712 SW MARYVILLE PL, LEES SUMMIT, MO 640823716 SW MARYVILLE PL, LEES SUMMIT, MO
640823718 SW MARYVILLE PL, LEES SUMMIT, MO 640823710 SW MARYVILLE PL, LEES
SUMMIT, MO 64082

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
Rated Assembly Inspection	Kyle Beard	Failed	Monday, March 11, 2024

Corrective Action Required:

1	Miscellaneous Correction	3710 SW Maryville. Rated assembly fire block plywood needs to be installed 4 foot from the fire rated wall Hole in plywood at ridge in fire block plywood needs to be repaired Hole in vertical wall at roof needs to be repaired All vertical wall sheet rock that has the outer paper damaged needs to be caulked with fire caulking 3712 regular plywood for roof was used within 4 feet of north fire wall Repair sheet rock paper in vertical south wall upstairs 3716 Fire block plywood at ridge has more than a 1/4 inch gap Repair all missing vertical sheet rock that has damaged sheet rock paper 3718 Fire block plywood at ridge has more than a 1/4 inch gap All plywood for roof needs to be fire block plywood within 4 feet of fire wall
---	--------------------------	---

Repair sheet rock at roof

Comments: