

CITY OF LEE'S SUMMIT  
Development Services Department  
220 SE Green Street  
Lee's Summit, MO 64063  
(816)969-1200  
**DEVSERVICES.CITYOFLS.NET**

## Inspection Summary

Permit #: PRRES20236052

Address: 3712 SW MARYVILLE PL, LEES SUMMIT, MO 640823716 SW MARYVILLE PL, LEES SUMMIT, MO  
640823718 SW MARYVILLE PL, LEES SUMMIT, MO 640823710 SW MARYVILLE PL, LEES  
SUMMIT, MO 64082

---

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
<b>Rated Assembly Inspection</b>	Kyle Beard	Failed	Friday, March 15, 2024

Corrective Action Required:

2	Miscellaneous Correction	3710 SW Maryville. Rated assembly (2)  fire block plywood needs to be installed 4 foot from the fire rated wall (new fire blocking plywood at ridge does not have full coverage on untreated plywood underneath) All vertical wall sheet rock that has the outer paper damaged needs to be caulked with fire caulking  3712 regular plywood for roof was used within 4 feet of north fire wall (seal new plywood used along both ends)  3716 Fire block plywood at ridge has more than a 1/4 inch gap (untreated plywood was used to fill in the gap) . Other side or ridge was never addressed Repair all missing vertical sheet rock that has damaged sheet rock paper
---	-----------------------------	--

Comments: