CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

DEVSERVICES.CITYOFLS.NET

Inspection Summary

Permit #: PRCOM20231105

Address: 800 NW WARD RD, LEES SUMMIT, MO 64086

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

All Rough Inspection - Robb Popp Partial Wednesday, April 03,

Commercial 2024

Informational:

1 Misc -Building 1, Segment A, 1st through 4th Floor for first layer of rated assembly

behind all tubs approved

Corrective Action Required:

2 FIRST FLOOR

Corrective Action Required:

3 SECOND FLOOR Corrective Action Required:

4 THIRD FLOOR *E

*BUILDING A:

********UNITS AND CORRIDOR ONLY

- -THROUGHOUT
- -Install structrural straps at both sides of all overbored load bearing top plates
- -Complete vertical fireblocking at max 10' oc at double walls
- -Fire caulk all dryer ducts through exterior walls
 -Install kickers at trusses per structural plans S3.12

303

-Strap top plate at living room

304

- -Protect nm at bath
- -Bath fan cannot be in fire wall

- -Address over bored studs at living room $% \left\{ \left\{ 1\right\} \right\} =\left\{ 1\right\} =\left\{$
- 307
- -Strap top plate lapped less than 48" in closet
- -Provide stud shoe at party wall

308

- -No more than (2) nm cables allowed through top plate penetration at entry and bathroom
- -Dryer duct over spanned
- -Address hole bored in top cord of truss
- -Missing stud at back bedroom

312

-Overspanned dryer duct

Corrective Action Required:

5 FOURTH FLOOR

*BUILDING A:

*****UNITS AND CORRIDOR ONLY

**THROUGHOUT:

- -Decks not ready for inspection -OK FOR RC EXCEPT AS NOTED
- 400
- -Fire caulk dryer ducts through exterior wall

412

-Fire caulk dryer duct through exterior wall

Comments: