# CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200

# **DEVSERVICES.CITYOFLS.NET**

# **Inspection Summary**

Permit #: PRRES20240309

Address: 3736 SW CLAYTON PL, LEES SUMMIT, MO 640823738 SW CLAYTON PL, LEES SUMMIT, MO

640823740 SW CLAYTON PL, LEES SUMMIT, MO 640823734 SW CLAYTON PL, LEES

**SUMMIT, MO 64082** 

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection: Inspector: Outcome: Date:

All Rough Inspection - Kyle Beard Failed Wednesday, May 01,

Residential 2024

Corrective Action Required:

2 Miscellaneous 3734 SW Clayton. All rough

Correction

Garage anchor bolts must be placed in the middle 1/3 of sole plate Garage sole plate is missing the 5/8 inch anchor bolt with a plate

Address all missing garage anchor bolts

Nail bedroom 1 closet to code

Re attach vent fan flex pipe in bathroom 2

3736

anchor bolts in garage are not secured properly

Garage sole plate is missing the 5/8 inch anchor bolt with a plate

Address all missing garage anchor bolts

Have engineers letter for garage south sole plate not being supported by the

concrete foundation wall

All garage anchor bolts must be in the middle 1/3 of sole plate

Nail N/W dining room corner to code Fire block top plate in basement closet

3738

Secure anchor bolts in garage
Install garage anchor bolts 4-12 inches from the ends
Garage sole plate is missing the 5/8 inch anchor bolt with a plate
Fire blocking missing in joist space above garage Ibeam
Nail N/W corner of great room to code
Latterly truss bracing is blocking the required height clearance for the attic access
Nail S/W corner of bedroom one and closet to code
Fire block top plate in closet of basement

## 3740

Garage anchor bolts need to be in the middle 1/3 of sole plate Garage sole plate is missing the 5/8 inch anchor bolt with a plate Garage sole plate is missing required anchor bolts Have engineers letter address where sole plate is not fully on foundation wall

Nail front entry and dining room corners to code Truss tie down screw is missing in bedroom 2 Secure 10/2 wire in basement ceiling chase

### **Comments:**