CITY OF LEE'S SUMMIT Development Services Department 220 SE Green Street Lee's Summit, MO 64063 (816)969-1200 **DEVSERVICES.CITYOFLS.NET**

Inspection Summary

Permit #: PRCOM20231105 Address: 800 NW WARD RD, LEES SUMMIT, MO 64086

This work has been inspected and the inspection results noted below. Please schedule inspections once all corrective actions have been completed. Do not cover any work until approved.

Inspection:	Inspector:	Outcome:	Date:
All Rough Inspection - Commercial	Robb Popp	Partial	Friday, May 17, 2024
Informational: 1 Misc Corrective Action Required: 2 FIRST FLOOR	-Fireblock tops of d -Have engineer add corridor for elevato -Install truss bracing 109 -Strap top plate lap -Nail corners at 12" 112 -Complete framing	r shaft and stair tower g at joists/parralell walls p ped less than 48" at exter	lates at load bearing walls in per detail 2C on S3.12 ior corner by patio

	108 -Fireblock double walls 10' oc vertical -Complete line sets
Corrective Action Required: 3 SECOND FLOOR	105 -Install stud shoes at overbored studs -Seal gaps at vertical fireblocking
	103 -Install stud shoes at overbored studs in common wall -Replace overnotched studs under beam in corner -Protect sprinkler line at top plate in mechanical
	224 -Seal top plate penetrations -Tie walls together at top plate -Install anchor bolts at steel column
	226 -Clarify number of bearing studs under (4) Floor truss beam -Anchor steel post at garage door framing
	-Provide 1.5" of bearing for beam outside of unit 289 -Provide vertical fireblocking and stud shoes outside of unit 232
	Building A: Decks approved Shear walls approved
	Building B: -Shear walls behind tubs ok
Corrective Action Required: 4 THIRD FLOOR	*BUILDING A: -Approved
	*Building B: -Seal draft stops throughout -Complete fireproofing at structural steel columns -Provide hanger or structural screws for end joists at decks 313 -Strap top plates at exterior corner -Provide bearing studs at pocket beam
	314 -Strap all top plates lapped less than 48" -Nail truss bracing per detail
	315 -Complete pex, secure pex and provide bocca plate at corridor wall

	-Complete fireproofing at structural steel column -Strap top plates lapped less than 48"
	316 -Complete fireproofing at structural steel column -Strap top plates -Protect dryer box at corriidor -Missing H2.5s at deck
	317 -Connect exterior walls at deck -Provide bocca plate at corridor dwv
	318 -Missing fire collar at storm line -Secure all nm at max 4.5' vertical -Strap top plates lapped less than 48" -Strap exterior corner -Secure nm within 12" at range
Corrective Action Required:	
5 FOURTH FLOOR	*BUILDING A: -Approved
	*Building B: -Approved
Corrective Action Required: 6 ELEVATOR 1	**ELEVATOR A: -Ok for rock on inside of shaft all floors
Corrective Action Required: 7 STAIR TOWER 5 Corrective Action Required: 8 STAIR TOWER 1	Stair tower D: -Shear wall nailing pattern complete
	*Stair A -Approved
Corrective Action Required: 9 ELEVATOR 2	Elevator in building C -Framing approved

Comments: